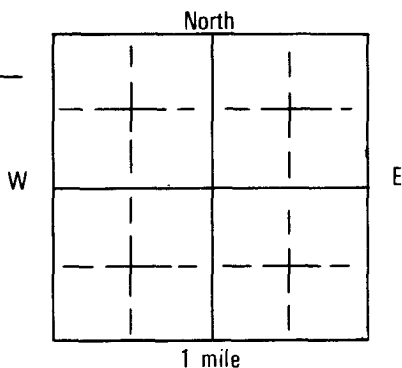


SOUTH DAKOTA WELL AND TEST HOLE PLUGGING REPORT

10-85

Location $\frac{1}{4}$ SE $\frac{1}{4}$ Sec 6 Twp 121 Rg 66

County

EdmundsPlease mark well
location with
an "X"

Well Owner:

Name

Gary Zabalka

Address

Ipswich, Co. Dak.

Plugging completion

Date

11-5-85

CHECK APPROPRIATE BOX

EXISTING WELL



TEST HOLE



Well depth

1515'

Casing material

Steel

Casing size(s)

5", 2" x-hwy

Casing condition

detached - holes,separated

Hole depth

75

Hole size

Describe plugging procedure: Removed separated 2" x-hwy - installed 294'-6 1/2" of 3 1/2" id casing inside 5" & over 2" x-hwy - cemented between 3 1/2" & 5", 10-15-85 - 200 sls.
cemented thru 3 1/2", 10-31-85 - 100 sls.
cemented between 3 1/2" & 5", 10-28-85 - 50 sls, cemented w/ 200 sls thru 3 1/2" - 10-28-85

Describe grout or plugging material:

Portland - 6 x 1 mix - bentonite & brn additives

Type of non-slip plug:

NoneThis well or test hole was plugged under license # 29 And this report is true and accurate.

Drilling firm

Independent Drilling Co., Inc.

Signature of Licensed Representative

Robert E. General

Signature of Well Owner

(absent - address unknown)

Date


7-22-86

SOUTH DAKOTA WELL AND TEST HOLE PLUGGING REPORT

10-85

Location $\frac{1}{4}$ SE $\frac{1}{4}$ Sec 6 Twp 121 Rg 68County Glenn

Please mark well location with an "X"

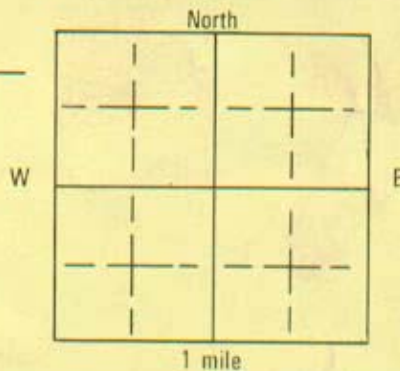

Well Owner:

Name Gary ZabelerAddress Ipewich, S. Dak.

Plugging completion

Date 11-5-85

CHECK APPROPRIATE BOX

EXISTING WELL ☒TEST HOLE ☐Well depth 1575'Casing material SteelCasing size(s) 5", 2" x-bayCasing condition damaged - holes
separatedHole depth 25'

Hole size _____

Describe plugging procedure: Removed separated 2" x-bay - installed 294'-6 1/2" of 3 1/2" ID casing inside 5" & over 2" x-bay - cemented between 3 1/2" ID - 10-15-85 - 200 lbs. cemented thru 3 1/2" 10-31-85 - 100 lbs. cemented between 3 1/2" ID - 10-28-85 - 50 lbs. cemented up to 3 1/2" ID - 10-28-85Describe grout or plugging material: Portland - 6 x 1 mix - bentonite & brown additiveType of non-slip plug: NoneThis well or test hole was plugged under license # 29

And this report is true and accurate.

Drilling firm Independent Drilling Co., Inc.Signature of Licensed Representative Robert E. JensenSignature of Well Owner (absent - address unknown)Date 7-22-86