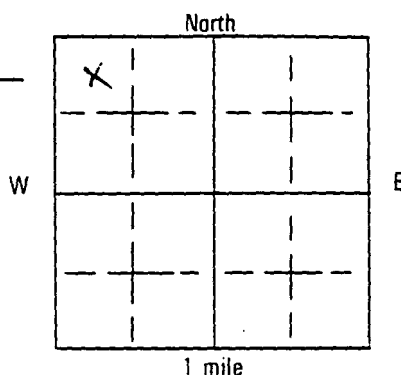


SOUTH DAKOTA WELL AND TEST HOLE PLUGGING REPORT

10-85

Location NW 1/4 NW 1/4 Sec 25 Twp 127 Rg 58

County

MarshallPlease mark well
location with
an "X"

Well Owner:

Name Marshall Co Health Care

Address

Britton SD

Plugging completion

Date 9/14/00

CHECK APPROPRIATE BOX

EXISTING WELL



TEST HOLE



Well depth

See Attached Logs

Hole depth

See Attached Logs


Casing material

Casing size(s)

Casing condition

Hole size

Describe plugging procedure: The well casings were filled with Bentonite to 1' from the surface. The manhole covers were removed and the surface holes were plugged with matching materials. 1 well in grass 1 well in asphalt

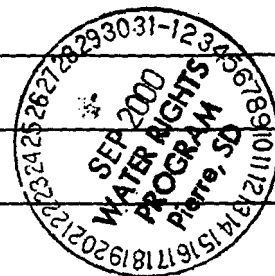Describe grout or plugging material: Bentonite chips

Type of non-slip plug:

This well or test hole was plugged under license # 575 And this report is true and accurate.


Drilling firm

American Engineering Testing


Signature of Licensed Representative

Glymalen

Signature of Well Owner

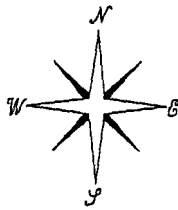

Parking Lot
(Asphalt)

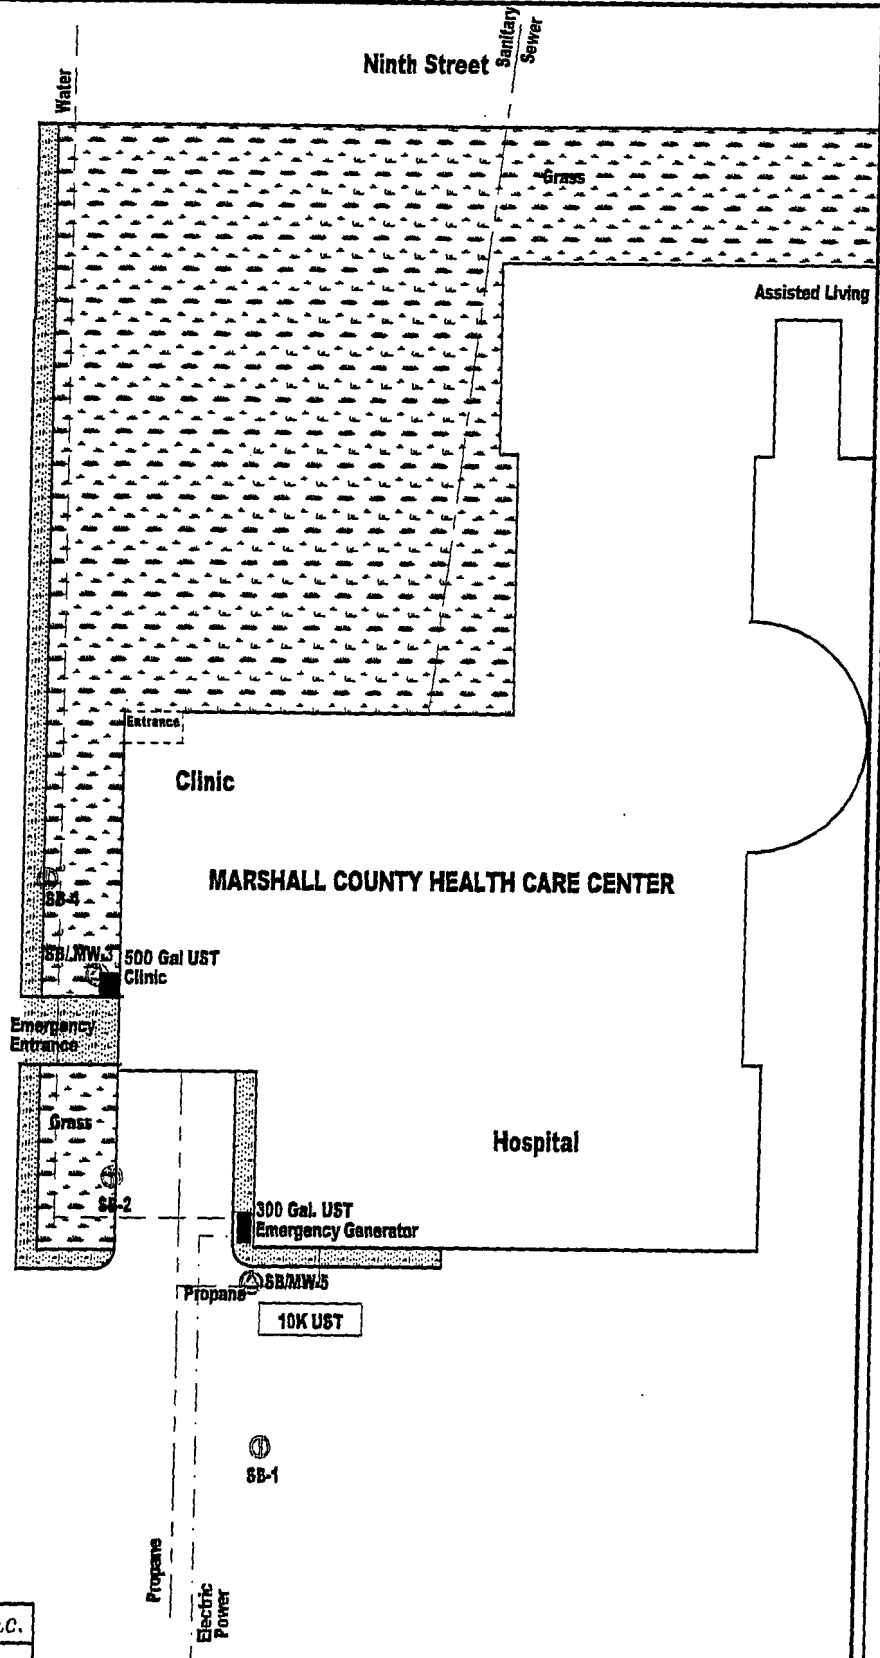

Environmental Technologies, Inc.

DATE	DRAWN BY	ETI PROJECT NUMBER
12/30/99	D. Pfahler	07600.002

FIGURE 2.

MARSHALL COUNTY HEALTH CARE
BRITTON, SOUTH DAKOTA

SCALE
1" = 50'

ENVIRONMENTAL TECHNOLOGIES, INC.

GROUNDWATER MONITORING WELL INSTALLATION REPORT

South Dakota License Number 575

Monitoring Well Number MW-3

Project Name Marshall County Health Care

Project Location Britton, SD

ETI Project Number 07798.002

Installed By ETI

Date Installed 12/16/99

Method of Installation Truck mounted "Mobil" drilling rig with an 6.5 inch

outside diameter hollow-stem auger. Samples obtained in advance of the

auger's tip with a standard split-spoon sampler.

LOG OF SOIL BORING & MONITORING WELL

SOIL BORING INFORMATION


MONITORING WELL INFORMATION

Depth in Ft.	Description	H*Nu Reading
0	Clayey Silt & Silty Clay, Brown	
1	Partial Retrieval	<1
2	Clayey Silt & Silty Clay, Brown	
3	Partial Retrieval	<1
4	Clayey Silt & Silty Clay, Brown w/ Grey; Slight Fuel Oil Odor	9
5	Clayey Silt & Silty Clay, Grey, Soft, Moist, Fuel Oil Odor	65
6	Clayey Silt & Silty Clay, Olive to Grey, Soft, Moist, Fuel Oil Odor	52
7	Clayey Silt & Silty Clay, Olive w/ Grey Streaks	11
8	Clayey Silt & Silty Clay, Brown w/ Minor Grey Streaks	2
9	EOB:15.5'	
10		
11		
12		
13		
14		
15		
16		
17		
18		
19		
20		
21		
22		
23		
24		
25		
26		
27		
28		
29		
30		
31		

Ground Elevation 100.33'

Top of Riser Elevation 100.00'

Static Water Level 6.73'

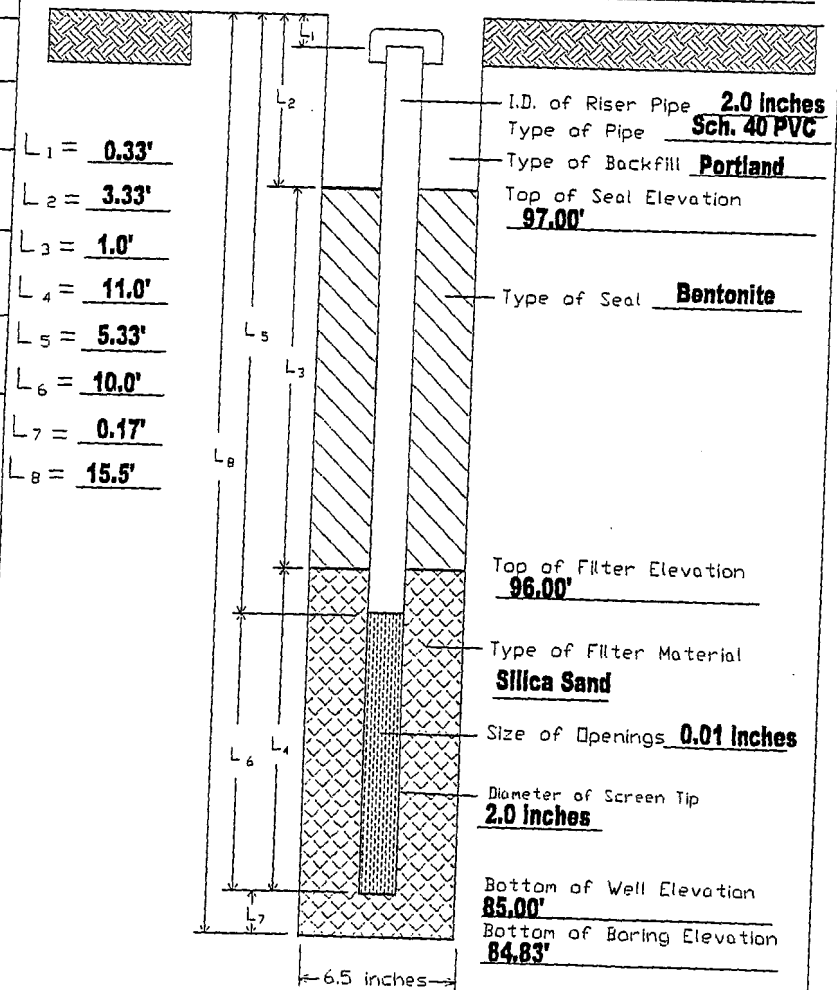

Remarks _____

Prepared by Dave Pfahler

ENVIRONMENTAL TECHNOLOGIES, INC.

GROUNDWATER MONITORING WELL INSTALLATION REPORT

South Dakota License Number 575

Monitoring Well Number MW-5

Project Name Marshall County Health Care

Project Location Britton, SD

ETI Project Number 07798.002

Installed By ETI

Date Installed 12/16/99

Method of Installation Truck mounted "Mobil" drilling rig with an 6.5 inch

outside diameter hollow-stem auger. Samples obtained in advance of the

auger's tip with a standard split-spoon sampler.

LOG OF SOIL BORING & MONITORING WELL

SOIL BORING INFORMATION


Depth in Ft.	Description	H#Nu Reading
0	Clayey Silt & Silty Clay, Brown	
1		
2		<1
3	Clayey Silt & Silty Clay, Dark Brown to Brown	
4		<1
5	Clayey Silt & Silty Clay, Olive to Brown, Stiff	
6		<1
7	Clayey Silt & Silty Clay, Brown, Stiff	
8		<1
9	Clayey Silt & Silty Clay, Brown, Stiff	
10		1
11	Clayey Silt & Silty Clay, Brown, Stiff, Wet	
12		1
13	Clayey Silt & Silty Clay, Brown, Stiff, Wet	
14		<1
15	EOB:15.5'	
16		
17		
18		
19		
20		
21		
22		
23		
24		
25		
26		
27		
28		
29		
30		
31		

MONITORING WELL INFORMATION

Ground Elevation 99.48'

Top of Riser Elevation 99.12'

Static Water Level 6.08'

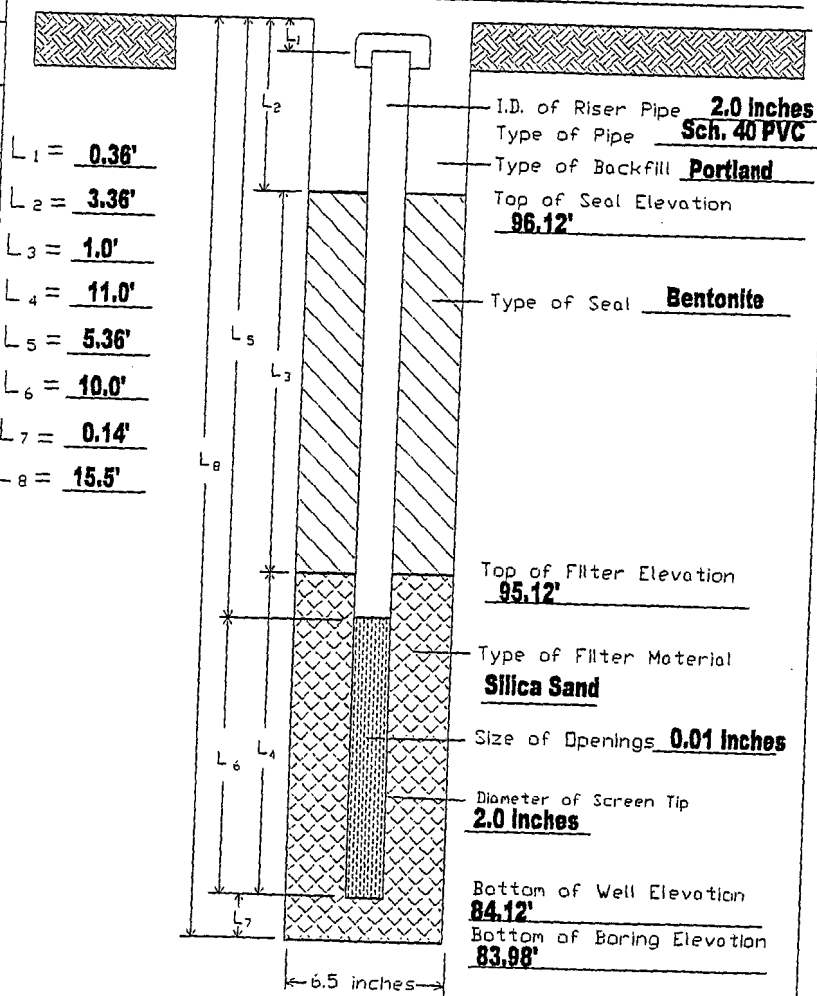

Remarks _____

Prepared by Dave Pfahler