

SOUTH DAKOTA WATER WELL COMPLETION REPORT

07-92

Location NW 1/4 NW 1/4 Sec 20 Twp 112 Rg 65

County

Beadle

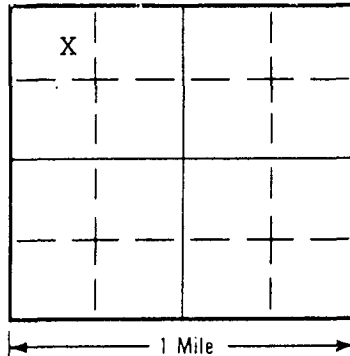
North

Please mark well location with an "X"

W

E

Well Completion Date

12-1-03

LOCATION:

Distance from nearest potential pollution source (septic tank, abandoned well, feed lot, etc.)? 300 ft. from septic (identify source).

PROPOSED USE:

☒ Domestic/Stock ☐ Municipal ☐ Business ☐ Test Holes
☐ Irrigation ☐ Industrial ☐ Institutional ☐ Monitoring well

METHOD OF DRILLING:

RotaryCASING DATA: ☐ Steel ☒ Plastic ☐ Other

If other describe _____

PIPEWEIGHT	DIAMETER	FROM	TO	HOLE DIAMETER
<u>200</u> LB/FT	<u>5</u> IN	<u>0</u> FT	<u>150</u> FT	<u>8</u> IN
<u>#80</u> LB/FT	<u>2</u> IN	<u>150</u> FT	<u>1050</u> FT	<u>4 1/2</u> IN
_____ LB/FT	_____ IN	_____ FT	_____ FT	_____ IN

GROUTING DATA

Grout Type	No. of Sacks	Grout Weight	From	To
_____	_____	_____ lb./gal	_____ ft.	_____ ft.
_____	_____	_____ lb./gal	_____ ft.	_____ ft.

Describe grouting procedure _____

SCREEN: ☒ Perforated pipe ☐ ManufacturedDiameter 2 IN Length 60 FEETMaterial PVCSlot Size .18 Set From 990 Feet to 1060 Feet

Other information _____

WAS A PACKER OR SEAL USED? ☒ YES ☐ NOIf so, what material? RubberDescribe packer(s) and location? Above perf

DISINFECTION: Was well disinfected upon completion?

☒ YES, How: HTH

Laboratory sent to for water quality analysis

Pierre, SDWell Owner: Lyle RowenBusiness Name: Triple R Inc.Address: 414 E. 2nd St.Miller, SD 57362

WELL LOG:

DEPTH

FORMATION	DEPTH	
	FROM	TO
Top soil	0	2
Yellow clay	2	30
Blue clay-sand streaks	30	75
Shale	75	570
Greenhorn	570	585
Shale	585	855
Dakota	855	1050

STATIC WATER LEVEL 9' Feet

If flowing: closed in pressure _____ PS.

GPM flow _____ through _____ inch pipe

Controlled by ☐ Valve ☐ Reducers ☐ Other _____

Reduced Flowrate _____ GPM

Can well be completely shut in? _____

WELL TEST DATA:

☒ Pumped Describe: Compressed Air☐ Bailed☐ Other

Pumping Level Below Land Surface

35 ft. After 24 Hrs. pumped 40 GPM

_____ ft. After _____ Hrs. pumped _____ GPM

If pump installed, pump rate _____ GPM

REMARKS

RECEIVED

DEC 23 2003

This well was drilled under license # 94

And this report is true and accurate.

Drilling firm Huron Drilling Inc.

Signature of License Representative

Signature of Well Owner or Equitable Property Holder

Date: 12-1-03

WATER RIGHTS PROGRAM

12-31-03