# SOUTH DAKOTA WELL AND TEST HOLE PLUGGING REPORT

10-85

Location ¼ SE ¼ Sec 35 Twp 101N Rg 51W

County Minnehaha

Please mark well location with an "X"
See inclosed Site Plan MW-18-1D

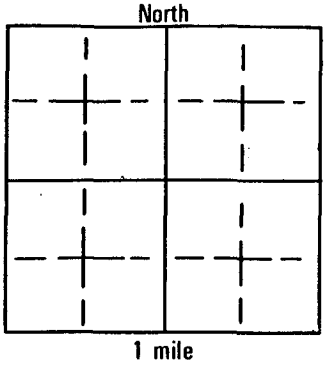


Well Owner: Mr. Dave McElroy

Name City of Sioux Falls Public Works Dept.

Address 224 W 9th Street

Sioux Falls, S.D. 57104

Plugging completion Date 10/19/11

## CHECK APPROPRIATE BOX

EXISTING WELL ☒ TEST HOLE ☐

Well depth 45'

Casing material Sch 40 PVC

Casing size(s) 2"

Casing condition Good

Hole depth

Hole size

Describe plugging procedure: Clean Sand placed from 45' to 25'. Bentonite chips (hydrated) placed from 25' to 21'. Neat cement placed from 21' to 2'. Native material placed from 2' to surface. All hand placed.

Describe grout or plugging material: Neat cement: Portland Type II mixed 94 lbs/6 gal H2o.

Type of non-slip plug: Hydrated Bentonite Chips

This well or test hole was plugged under license # 617 And this report is true and accurate.

Drilling firm American Technical Services

Signature of Licensed Representative Mike Hudson

Signature of Well Owner

Date 1/30/2012

# SOUTH DAKOTA WELL AND TEST HOLE PLUGGING REPORT

10-85

Location ¼ SE ¼ Sec 35 Twp 101N Rg 51W

County Minnehaha

Please mark well location with an "X"
See enclosed Site Plan MW-18

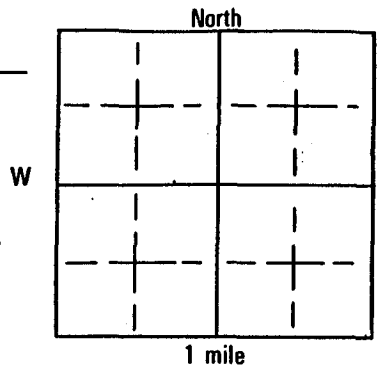


Well Owner: Mr. Dave McElroy

Name City of Sioux Falls Public Works Dept.

Address 224 W 9th Street

Sioux Falls, S.D. 57104

Plugging completion Date 10/9/11

## CHECK APPROPRIATE BOX

| EXISTING WELL ☒ | TEST HOLE ☐ |
|---|---|
| Well depth 18' | Hole depth |
| Casing material Sch 40 PVC | Hole size |
| Casing size(s) 1" | |
| Casing condition Good | |

Describe plugging procedure: Clean Sand placed from 18' to 6'. Bentonite Chips (Hydrated) placed from 6' to 4'. Neat Cement placed from 4' to 2'. Native Material placed from 2' to Surface. All Hand placed.

Describe grout or plugging material: Neat Cement: Portland Type II mixed 94 LBS/6 gals H2O.

Type of non-slip plug: Hydrated Bentonite Chips

This well or test hole was plugged under license # 617 And this report is true and accurate.

Drilling firm American Technical Services

Signature of Licensed Representative Mike Hudson

Signature of Well Owner

Date 1/30/2012

# SOUTH DAKOTA WELL AND TEST HOLE PLUGGING REPORT

10-85

Location ¼ SE ¼ Sec 35 Twp 101N Rg 51W

County Minnehaha

Please mark well location with an "X"
see inclosed site plan
NW-GP18-15

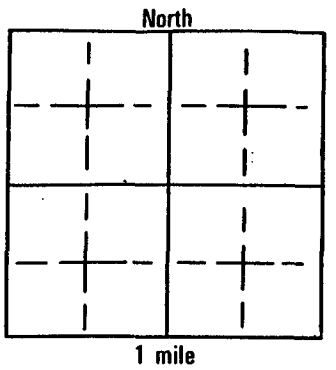


Well Owner: Mr. Dave McElroy

Name City of Sioux Falls Public Works Dept.

Address 224 W 9th Street

Sioux Falls, S.D. 57104

Plugging completion Date 10/19/11

## CHECK APPROPRIATE BOX

| EXISTING WELL ☒ | TEST HOLE ☐ |
|---|---|
| Well depth 18' | Hole depth |
| Casing material Sch 40 PVC | Hole size |
| Casing size(s) 1" | |
| Casing condition Good | |

Describe plugging procedure: Clean sand placed from 18' to 6'. Bentonite Chips (Hydrated) placed from 6' to 4'. Neat Cement placed from 4' to 2'. Native material placed from 2' to Surface. All Hand placed.

Describe grout or plugging material: Neat Cement: Portland Type II mixed 94 LBS/6 gal $H_2O$

Type of non-slip plug: Hydrated Bentonite Chips

This well or test hole was plugged under license # 617 And this report is true and accurate.

Drilling firm American Technical Services

Signature of Licensed Representative Mike Hudson

Signature of Well Owner

Date 1/30/2012

# SOUTH DAKOTA WELL AND TEST HOLE PLUGGING REPORT

10-85

Location ¼ SE ¼ Sec 35 Twp 101N Rg 51W

County Minnehaha

Please mark well location with an "X"
See inclosed Site Plan GP 18-2

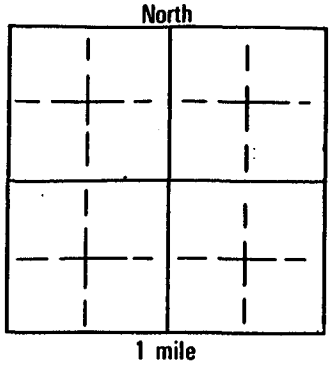


Well Owner: Mr. Dave McElroy

Name City of Sioux Falls Public Works Dept.

Address 224 W 9th Street

Sioux Falls, S.D. 57104

Plugging completion Date 10/19/11

## CHECK APPROPRIATE BOX

EXISTING WELL ☒

Well depth 45'

Casing material Sch 40 PVC

Casing size(s) 1"

Casing condition Good

TEST HOLE ☐

Hole depth

Hole size

Describe plugging procedure: Clean sand placed from 45' to 25'. Bentonite chips (Hydrated) placed from 25' to 21'. Neat Cement placed from 21' to 2'. Native Material placed from 2' to Surface. All Hand placed.

Describe grout or plugging material: Neat Cement: Portland Type II mixed 94 LBS/6gal $H_2O$

Type of non-slip plug: Hydrated Bentonite Chips

This well or test hole was plugged under license # 617 And this report is true and accurate.

Drilling firm American Technical Services

Signature of Licensed Representative Mike Hudson

Signature of Well Owner

Date 1/30/2012

# SOUTH DAKOTA WELL AND TEST HOLE PLUGGING REPORT

10-85

Location ¼ SE ¼ Sec 35 Twp 101N Rg 51W

County Minnehaha

Please mark well location with an "X"
See enclosed Site Plan GP 18-3

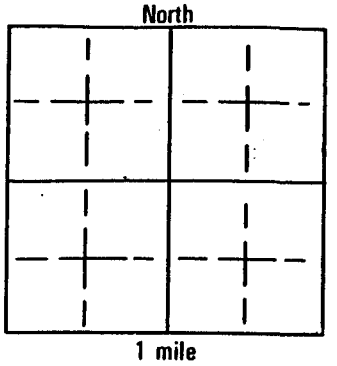


Well Owner: Mr. Dave McElroy

Name City of Sioux Falls Public Works Dept.

Address 224 W 9th Street

Sioux Falls, S.D. 57104

Plugging completion Date 10/19/11

## CHECK APPROPRIATE BOX

| EXISTING WELL ☒ | TEST HOLE ☐ |
|---|---|
| Well depth 18' | Hole depth |
| Casing material Sch 40 PVC | Hole size |
| Casing size(s) 1" | |
| Casing condition Good | |

Describe plugging procedure: Clean sand placed from 18' to 6'. Bentonite Chips (Hydrated) placed from 6' to 4'. Neat Cement placed from 4' to 2'. Native material placed from 2' to Surface. All Hand placed.

Describe grout or plugging material: Neat Cement: Portland Type II mixed 94LBS/6gal H2O.

Type of non-slip plug: Hydrated Bentonite Chips

This well or test hole was plugged under license # 617 And this report is true and accurate.

Drilling firm American Technical Services

Signature of Licensed Representative Mike Hudson

Signature of Well Owner

Date 1/30/2012

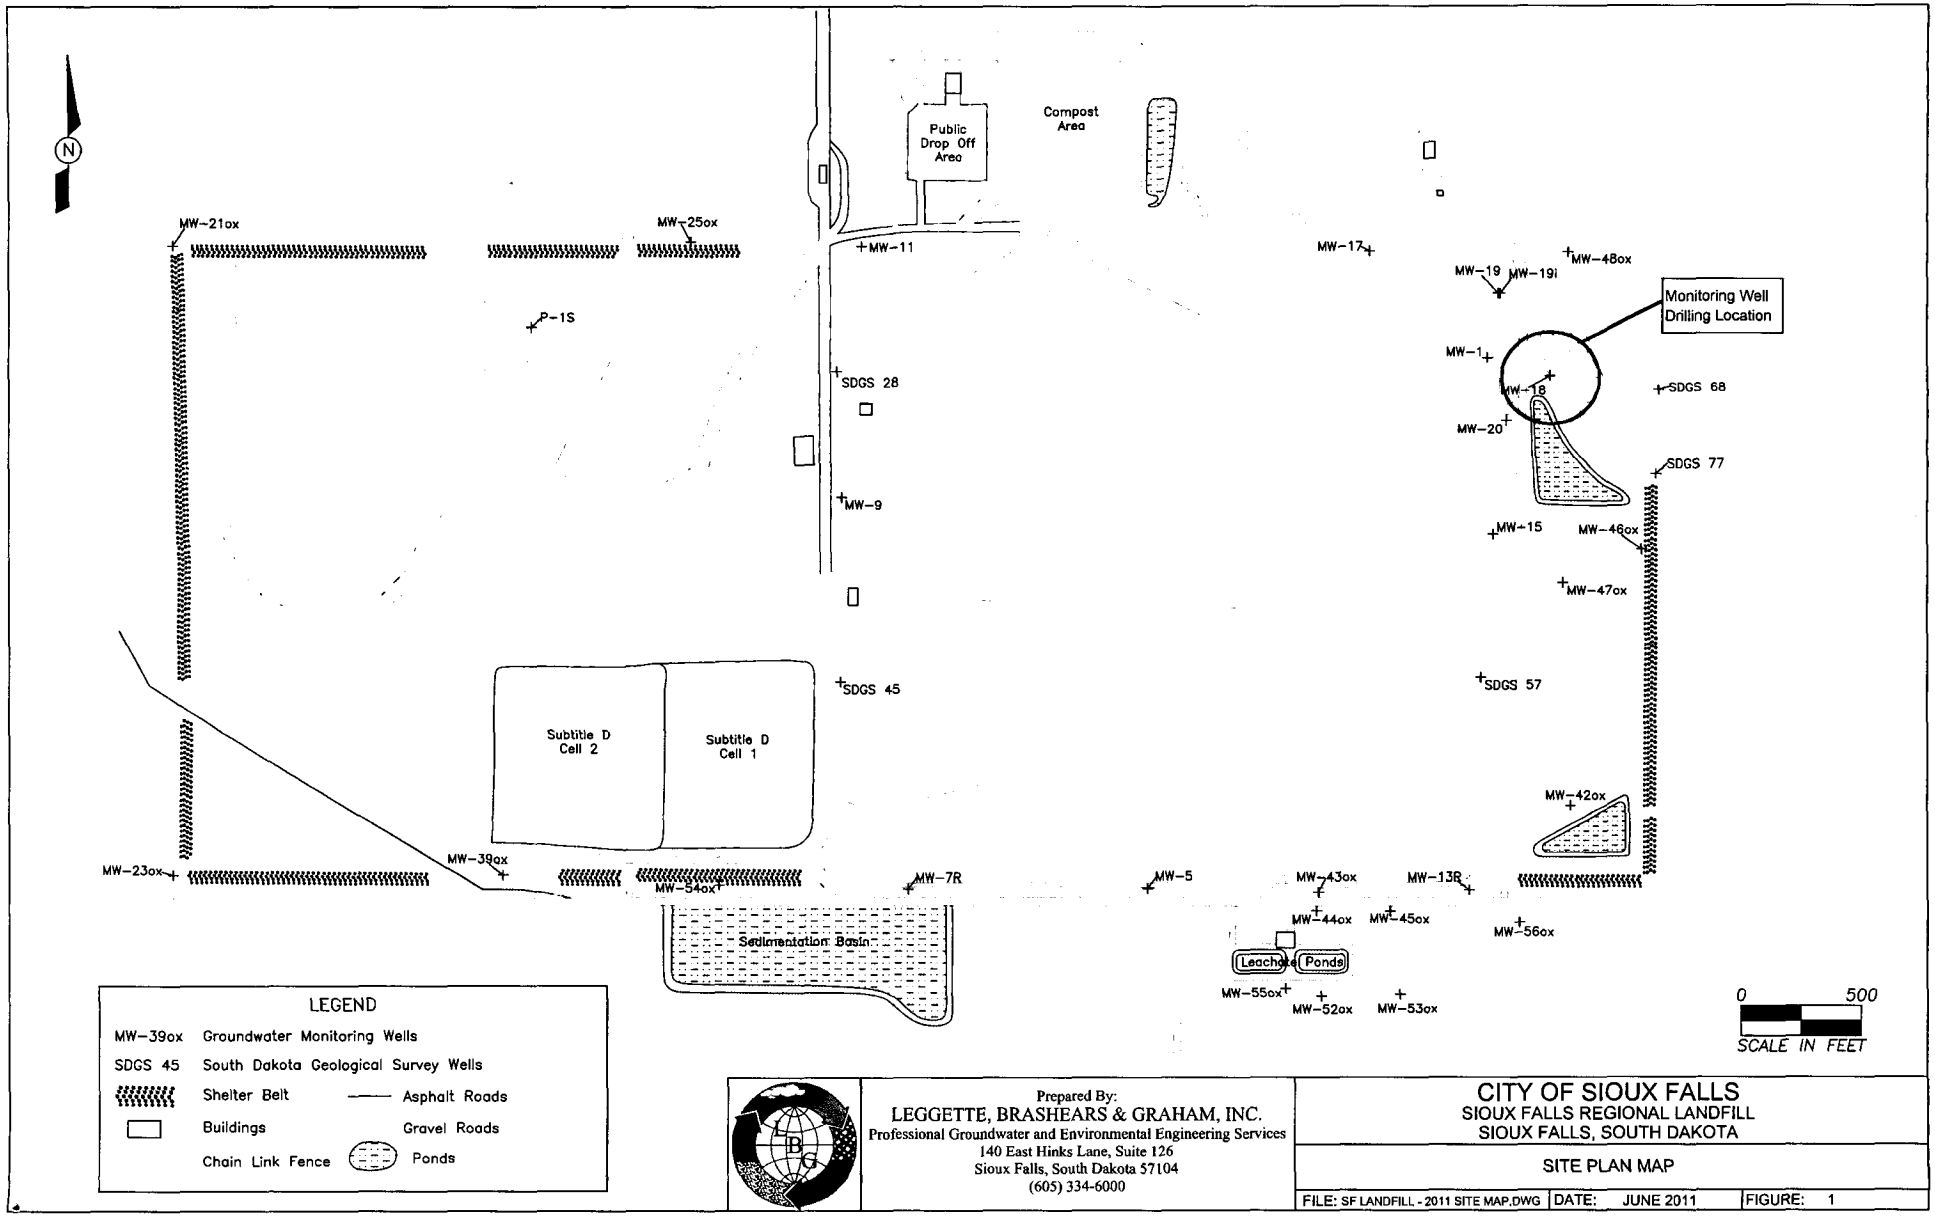


Prepared By:
LEGGETTE, BRASHEARS & GRAHAM, INC.
Professional Groundwater and Environmental Engineering Services
140 East Hinks Lane, Suite 126
Sioux Falls, South Dakota 57104
(605) 334-6000

# CITY OF SIOUX FALLS
## SIOUX FALLS REGIONAL LANDFILL
## SIOUX FALLS, SOUTH DAKOTA

SITE PLAN MAP

FILE: SF LANDFILL - 2011 SITE MAP.DWG | DATE: JUNE 2011 | FIGURE: 1

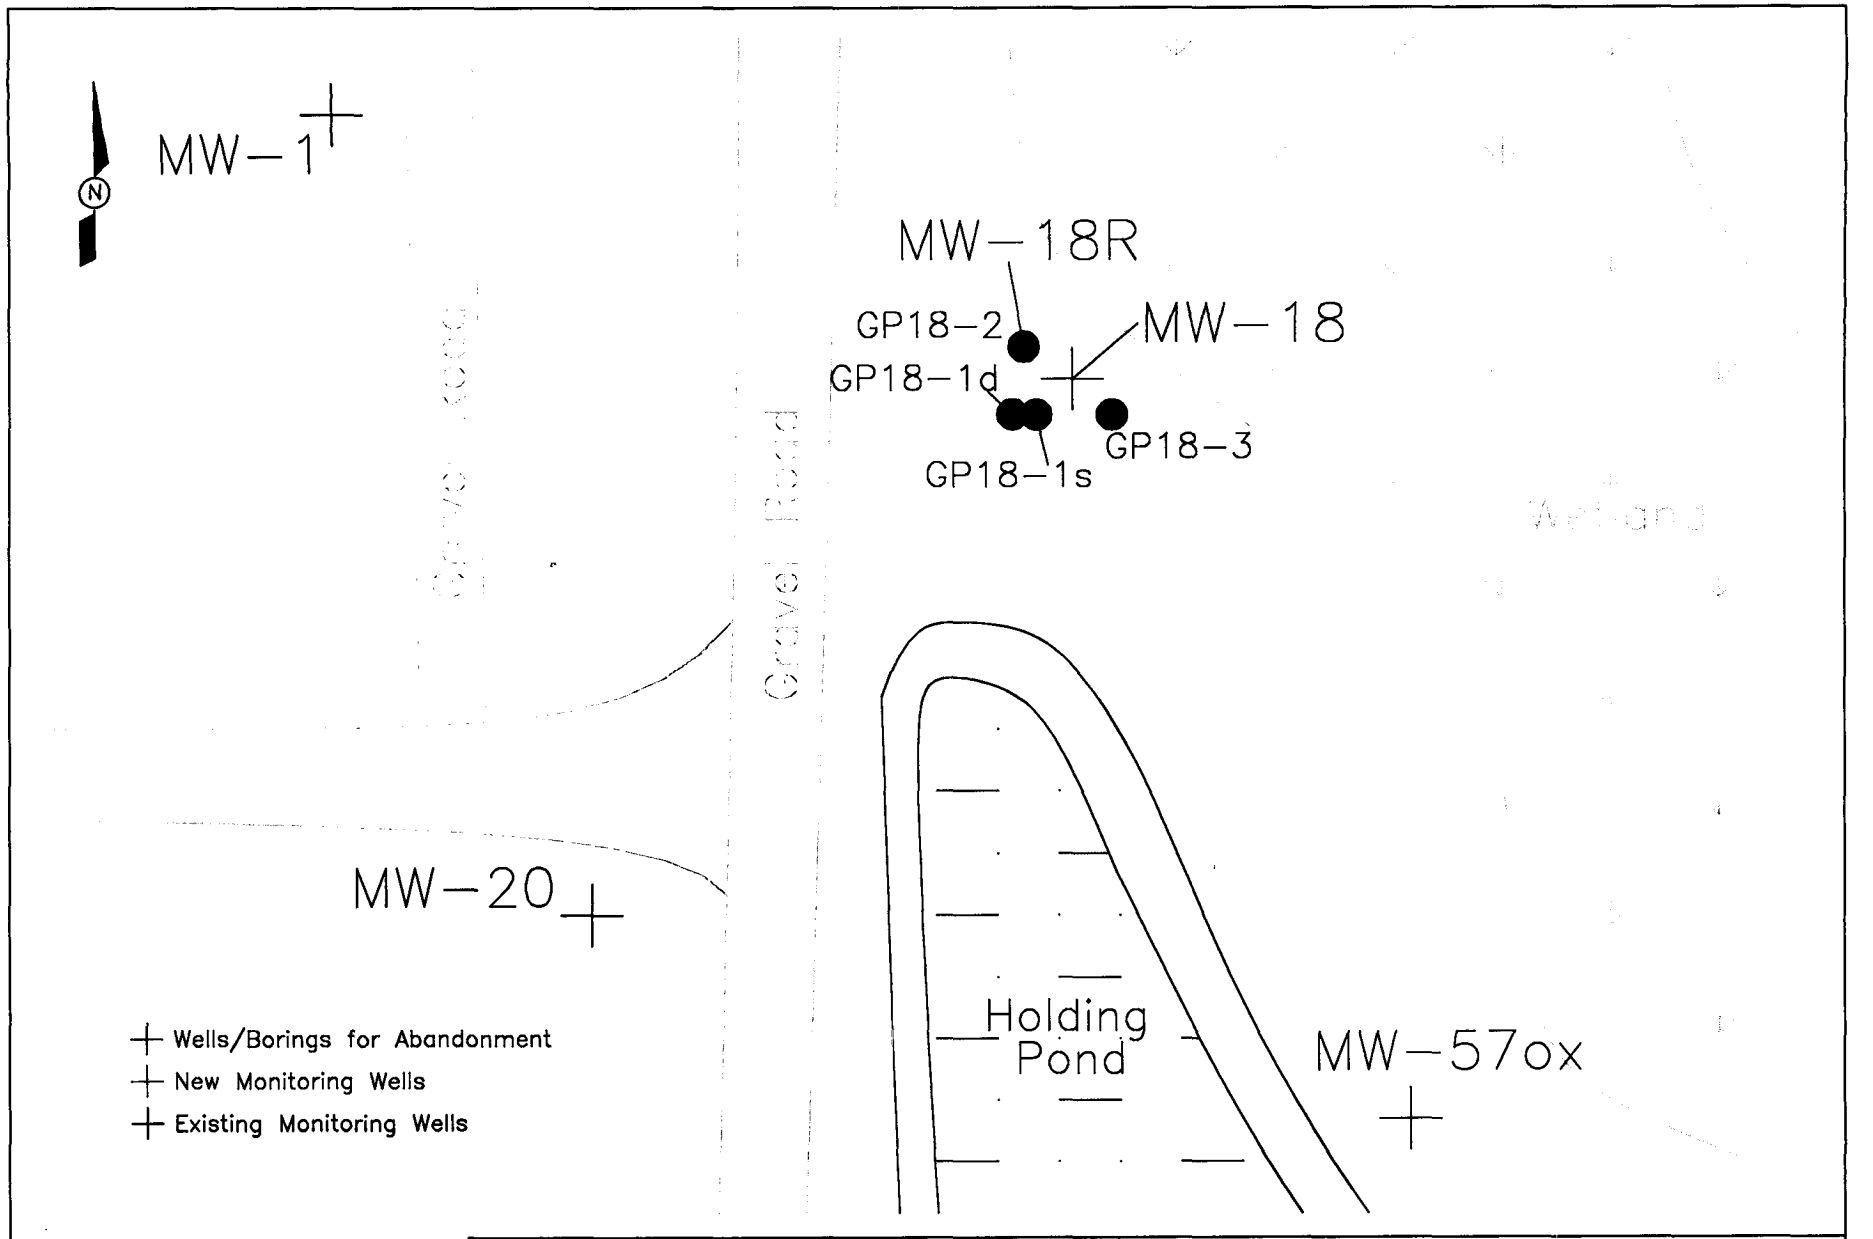


Prepared By:
LEGGETTE, BRASHEARS & GRAHAM, INC.
Professional Groundwater and Environmental Engineering Services
140 East Hinks Lane
Suite 126
Sioux Falls, South Dakota 57104
(605) 334-6000

# CITY OF SIOUX FALLS

SIOUX FALLS REGIONAL LANDFILL
SIOUX FALLS, SOUTH DAKOTA

MONITORING WELL INSTALLATION & ABANDONMENT

| FILE: SF LANDFILL - 2011 SITE MAP.DWG | DATE: October 2011 | FIGURE: 1 |
|---|---|---|