


SOUTH DAKOTA WATER WELL COMPLETION REPORT

07-92

Location SW 1/4 Sec 1 Twp 116N Rg 54W
 County Codington

Please mark well location with an "X"

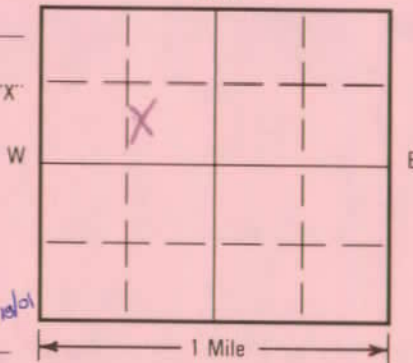

Well Completion Date

8/8/1999

KB 7/12/01

LOCATION:

Distance from nearest potential pollution source (septic tank, abandoned well, feed lot, etc.)? NA ft. from empty lot well list (identify source).

PROPOSED USE:

- ☒ Domestic/Stock ☐ Municipal ☐ Business ☐ Test Holes
☐ Irrigation ☐ Industrial ☐ Institutional ☐ Monitoring well

METHOD OF DRILLING:

direct rotary

CASING DATA: ☐ Steel ☒ Plastic ☐ Other

If other describe _____

PIPEWEIGHT	DIAMETER	FROM	TO	HOLE DIAMETER
<u>Sch 40</u> LB/FT	<u>5</u> IN	<u>56</u> FT	<u>66</u> FT	<u>9</u> IN
_____ LB/FT	_____ IN	_____ FT	_____ FT	_____ IN
_____ LB/FT	_____ IN	_____ FT	_____ FT	_____ IN

GROUTING DATA

Grout Type	No. of Sacks	Grout Weight	From	To
<u>bentonite</u>	<u>109</u>	<u>10000</u> lb./gal	<u>56</u> ft	<u>56</u> ft
	<u>15.5</u>	<u>10.5</u> lb./gal	<u>56</u> ft	<u>66</u> ft

Describe grouting procedure tremie from bottom
pull back method

SCREEN: ☐ Perforated pipe ☒ Manufactured

Diameter 5 IN Length 10 FEET

Material Sch 40

Slot Size .035 Set From 56 Feet to 66 Feet

Other information _____

WAS A PACKER OR SEAL USED? ☒ YES ☐ NO

If so, what material? _____

Describe packer(s) and location? _____

DISINFECTION: Was well disinfected upon completion?

X YES, How: HTH Tablets

_____ NO, Why Not? _____

Laboratory sent to for water quality analysis

by owner

Well Owner: Terry Bous
 Business Name: _____
 Address: Wheaton SD 57201

WELL LOG:

FORMATION	DEPTH	
	FROM	TO
<u>black dirt</u>	<u>0</u>	<u>4</u>
<u>yellow clay</u>	<u>4</u>	<u>18</u>
<u>blue clay</u>	<u>18</u>	<u>62</u>
<u>grey sand</u>	<u>62</u>	<u>66</u>
<u>blue clay mixed w/ sand</u>	<u>66</u>	<u>72</u>

STATIC WATER LEVEL 8 Feet

If flowing: closed in pressure _____ PSI

GPM flow _____ through _____ inch pipe

Controlled by ☐ Valve ☐ Reducers ☐ Other _____

Reduced Flowrate _____ GPM

Can well be completely shut in? _____

WELL TEST DATA:

☐ Pumped Describe: Art Lift

☐ Bailed _____

☒ Other _____

Pumping Level Below Land Surface

_____ ft. After 5 Hrs. pumped 150+ GPM

_____ ft. After _____ Hrs. pumped _____ GPM

If pump installed, pump rate _____ GPM

REMARKS

This well was drilled under license # 331

And this report is true and accurate.

Drilling firm Kaiser Well Works

Signature of license Representative: _____

Signature of Well Owner or Equitable Property Holder: _____

Date: _____

