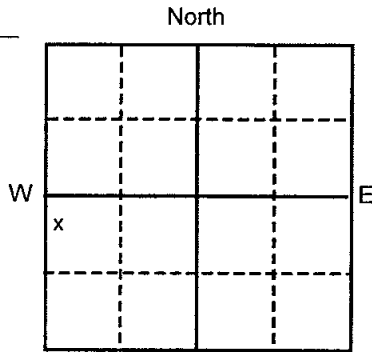


8162-3

SD EForm - 1621LD V1

SOUTH DAKOTA WATER WELL COMPLETION REPORT

11-02

Location nw 1/4 sw 1/4 Sec 9 Twp 94n Rg 53wCounty ClayPlease mark well
location with an "X"

Well Completion Date

12/29/14

Distance to nearest potential pollution source (septic tank, abandoned well, feed lot, etc.)?

1,000.0 ft. from Septic tank (identify source)

PROPOSED USE:

☐ Domestic/Stock ☐ Municipal ☐ Business ☐ Test holes
☒ Irrigation ☐ Industrial ☐ Institutional ☐ Monitoring well

METHOD OF DRILLING:

Bucket method

CASING DATA:

☐ Steel ☒ Plastic ☐ Other

If other describe

PIPEWEIGHT	DIAMETER	FROM	TO	HOLE DIAMETER
LB/FT	<u>16.00</u> IN	<u>0.0</u> FT	<u>45.0</u> FT	<u>20.00</u> IN
LB/FT	IN	FT	FT	IN
LB/FT	IN	FT	FT	IN

GROUTING DATA:

Grout Type	No. of Sacks	Grout Weight	From	To
<u>bentonite</u>	<u>20</u>	<u>9.5</u> Lb/gal	<u>0.0</u> Ft	<u>40.0</u> Ft
		Lb/gal	Ft	Ft

Describe grouting procedure
tremie

SCREEN:

☐ Perforated pipe ☒ Manufactured
Diameter 16.00 Inches Length 75.0 FeetMaterial pvcSlot Size .085 Set From 45.0 Feet to 120.0 Feet

Other information

WAS A PACKER OR SEAL USED?

☐ Yes ☒ No

If so, what material?

Describe packer(s) and location

DISINFECTION: Was well disinfected upon completion?

☒ Yes, How? hth tablets☐ No, Why Not?Lab to which water
quality sample sent for analysisWell Owner: Don SchellpfefferBusiness Name: Don Schell Family LLPAddress: 26912 Baker Park PlaceCity, State, Zip: Sioux Falls SD 57108

WELL LOG:

FORMATION	DEPTH	
	FROM	TO
Topsoil, dk brown	0	2
Clay, brown, pebbly, Till	2	20
Clay, gray, pebbly, till	20	45
Chalk, gray, wet	45	63
Chalk, gray, very hard, brittle	63	120

STATIC WATER LEVEL 18.0 FEET

If flowing: closed in pressure _____ PSI

GPM flow _____ through _____ Inch pipe

Controlled by ☐ Valve ☐ Reducers ☐ Other _____

Reduced flow rate _____ GPM

Can well be completely shut in?

WELL TEST DATA:

☒ Pumped Describe: _____☐ Bailed☐ Other

Pumping Level Below Land Surface

99.0 Ft. After 5.0 Hrs. pumped 125.0 GPM

_____ Ft. After _____ Hrs. pumped _____ GPM

If pump installed, pump rate: 100.0 GPM

REMARKS

RECEIVED

MAY 28 2015

WATER RIGHTS

PROGRAM

This well was drilled under license # _____ and this
report is true and accurate.Drilling firm: Hammond Wetmore Drilling, LLC.

Signature of License Representative:

Signature of Well Owner or Equitable Property Holder:

Date:

12/30/2014