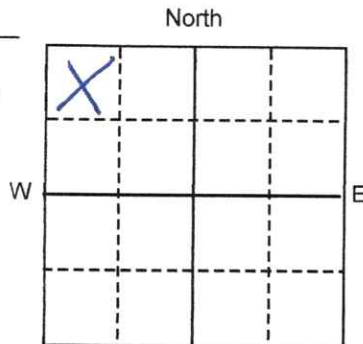


SOUTH DAKOTA WATER WELL COMPLETION REPORT

11-02

Location NW 1/4 NW 1/4 Sec 27 Twp 36N Rg 36WCounty BENNETTPlease mark well
location with an "X"

Well Completion Date

10-29-24

1 Mile

Distance to nearest potential pollution source (septic tank, abandoned well, feed lot, etc.)?
ft. from N/A (identify source)

PROPOSED USE:

☒ Domestic/Stock ☐ Municipal ☐ Business ☐ Test holes
☐ Irrigation ☐ Industrial ☐ Institutional ☐ Monitoring well

METHOD OF DRILLING:

ROTARY

CASING DATA:

☐ Steel ☒ Plastic ☐ Other

If other describe

PIPEWEIGHT	DIAMETER	FROM	TO	HOLE DIAMETER
200.0 LB/FT	9.00 IN	95.0 FT	6.0 FT	9.00 IN
200.0 LB/FT	9.00 IN	117.0 FT	115.0 FT	9.00 IN
LB/FT	IN	FT	FT	IN

GROUTING DATA:

Grout Type	No. of Sacks	Grout Weight	From	To
PORTLAND	4	94.6 Lb/gal	6.0 Ft	21.0 Ft
		Lb/gal	Ft	Ft

Describe grouting procedure

PUMPED

SCREEN:

☒ Perforated pipe ☐ Manufactured
Diameter 4.00 Inches Length 20.0 FeetMaterial PVCSlot Size .014 Set From 115.0 Feet to 95.0 FeetOther information ENVIRONMENTAL MANUFACTURING INCWAS A PACKER OR SEAL USED? ☐ Yes ☒ No

If so, what material?

Describe packer(s) and location

DISINFECTION: Was well disinfected upon completion?

☒ Yes, How? CHLORINATEDLab to which water
quality sample sent for analysisWell Owner: KEN KEEGAN

Business Name:

Address: 22820 CEDER CREEK RDCity, State, Zip: MARTIN SD 57551

WELL LOG:

FORMATION	DEPTH	
	FROM	TO
TOP SOIL	0	3
CLAY	3	8
SAND COARSE	8	16
SOFT HARD PACK SANDSTONE/ BEDROCK	16	117

STATIC WATER LEVEL 18.0 FEET

If flowing: closed in pressure _____ PSI

GPM flow _____ through _____ Inch pipe

Controlled by ☐ Valve ☐ Reducers ☐ Other _____

Reduced flow rate _____ GPM

Can well be completely shut in?

WELL TEST DATA:

☒ Pumped Describe: SUBMERSIBLE☐ Bailed☐ Other

Pumping Level Below Land Surface

105.0 Ft. After 1.5 Hrs. pumped 15.0 GPM

_____ Ft. After _____ Hrs. pumped _____ GPM

If pump installed, pump rate: 15.0 GPM

REMARKS

2-391
 15 SQ 290
 H2O 0 FT TO 6 FT
 N 43° 04' 23.15" W -101° 33' 0.97"

RECEIVED

JAN 27 2025

OFFICE OF
WATERThis well was drilled under license # 108 and this
report is true and accurate.Drilling firm: REIMERS WELL DRILLING LLC

Signature of License Representative:

Signature of Well Owner or Equitable Property Holder:

Date:

1-15-25