

SOUTH DAKOTA WATER WELL COMPLETION REPORT

2024

Location ne $\frac{1}{4}$ SE $\frac{1}{4}$ Sec 3 Twp 114 n Rg 52W

County

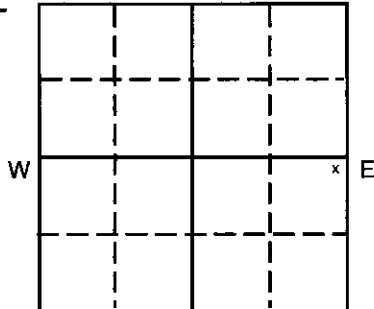
Hamlin

North

GPS Coordinates

Lat: _____

Lon: _____

Please mark well location
with an "X" on section grid

Well Completion Date

7/18/2025

Distance from nearest potential pollution source (Septic tank, abandoned well, feed lot, etc.)

? 100 _____ ft. from drain field (identify source)

PROPOSED USE:

- ☒ Domestic/Stock ☐ Municipal ☐ Business ☐ Monitoring Well
☐ Irrigation ☐ Industrial ☐ Institutional ☐ Test Hole
☐ Dewatering Well ☐ Geothermal ☐ Other _____

METHOD OF DRILLING:

CASING DATA: ☐ Steel ☒ Plastic ☐ Other

If other describe _____

PIPEWEIGHT	DIAMETER	FROM	TO	HOLE DIAMETER
SDR21 LB/FT	5 IN	0 FT	FT	83/4 IN
LB/FT	IN	FT	FT	IN
LB/FT	IN	FT	FT	IN

GROUTING DATA:

Grout Type	No. of Sacks	Grout Weight	From	To
bent high solids		Lb/gal	0.0 Ft	17.0 Ft
bent high solids		Lb/gal	Ft	Ft

Describe grouting procedure _____

SCREEN: ☐ Perforated pipe ☒ ManufacturedDiameter 5 Inches Length 13.0 FeetMaterial pvcSlot Size .040 Set From 19.0 Feet to 22.0 FeetOther information .025 set from 87 feet 97 feet
80/120 red flint sand pack all the way 19-97WAS A PACKER OR SEAL USED? ☐ Yes ☐ No

If so, what material? _____

Describe packer(s) and location _____

DISINFECTION: Was well disinfected upon completion?

☒ Yes, How? _____☐ No, Why Not? _____Lab sample sent to for
water quality analysis yes state sd labWell Owner: Thomas Olsen

RECEIVED

Business Name: _____

Address: 18455 458

MAY 13 2026

City, State, Zip: Castlewood, SD 57223OFFICE OF
WATER

WELL LOG:

DEPTH

FORMATION	FROM	TO
topsoil	0.0	2.0
yellow clay	2.0	4.0
sand lenses	4.0	23.0
sand lenses with clay layers soft	23.0	84.0
lenses mixed up sand with silt	87.0	97.0

STATIC WATER LEVEL 19.0 FEET

If flowing: closed in pressure _____ PSI

GPM flow _____ through _____ Inch pipe

Controlled by ☐ Valve ☐ Reducers ☐ Other _____

Reduced flow rate _____ GPM

Can well be completely shut in? _____

WELL TEST DATA:

☐ Pumped Describe: _____☐ Bailed ☐ Air☐ Other _____

Pumping Level Below Land Surface

90.0 Ft. After 6.0 Hrs. pumped 5.0 GPM

_____ Ft. After _____ Hrs. pumped _____ GPM

If pump installed, pump rate: 5.0 GPM

REMARKS

seems to yield a steady 5 gpm... old well
was just a curbed wellThis well was drilled under license # 480

And this report is true and accurate.

Drilling firm: Triple S Construction/jerry wieber rep

Signature of License Representative: _____

Signature of Well Owner or Equitable Property Holder: _____

Date: 2/2/26

Please return White Copy to DANR Water Rights 523 E. Capitol Ave., Pierre SD 57501